RADIO RECEIVER ASSY


REPLACEMENT

6709B–02

HINT:

COMPONENTS: See page 67–1

1. **REMOVE AIR CONDITIONER CONTROL ASSEMBLY(See page 71–10)**
2. **REMOVE INSTRUMENT CLUSTER FINISH PANEL SUB–ASSY CENTER (See page 71–10)**

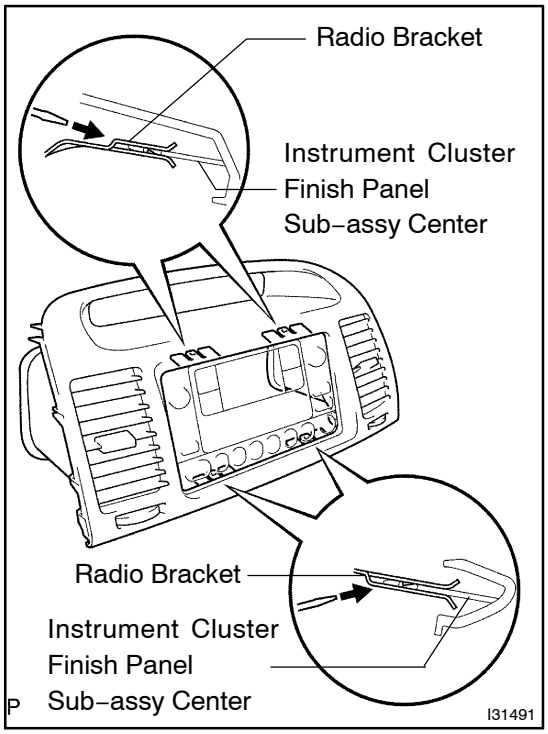


3. **REMOVE RADIO RECEIVER ASSY**

(a) Insert a screwdriver at indicated point and remove the radio receiver assy from instrument cluster finish panel sub–assy center.


HINT:

Tape the screwdriver tip before use.

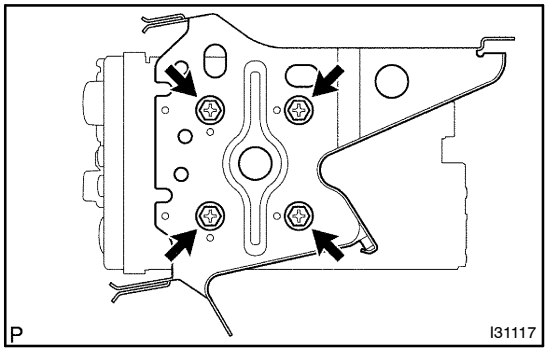

4. **REMOVE RADIO BRACKET NO.1**

(a) Remove the 4 screws and radio bracket No.1.

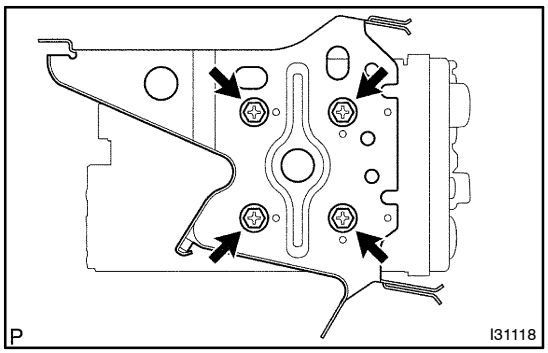

5. **REMOVE RADIO BRACKET NO.2**

(a) Remove the 4 screws and radio bracket No.2.