CLOCK ASSY


REPLACEMENT

7105R–01

HINT:

COMPONENTS: See page 71–7

1. **REMOVE AIR CONDITIONER CONTROL ASSEMBLY(See page 71–10)**
2. **REMOVE INSTRUMENT CLUSTER FINISH PANEL SUB–ASSY CENTER (See page 71–10)**

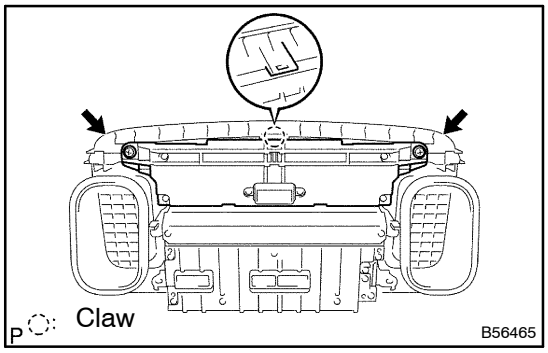

3. **REMOVE CLOCK ASSY**

(a) Remove the 2 screws.
(b) Disengage the claw and remove the clock assy.