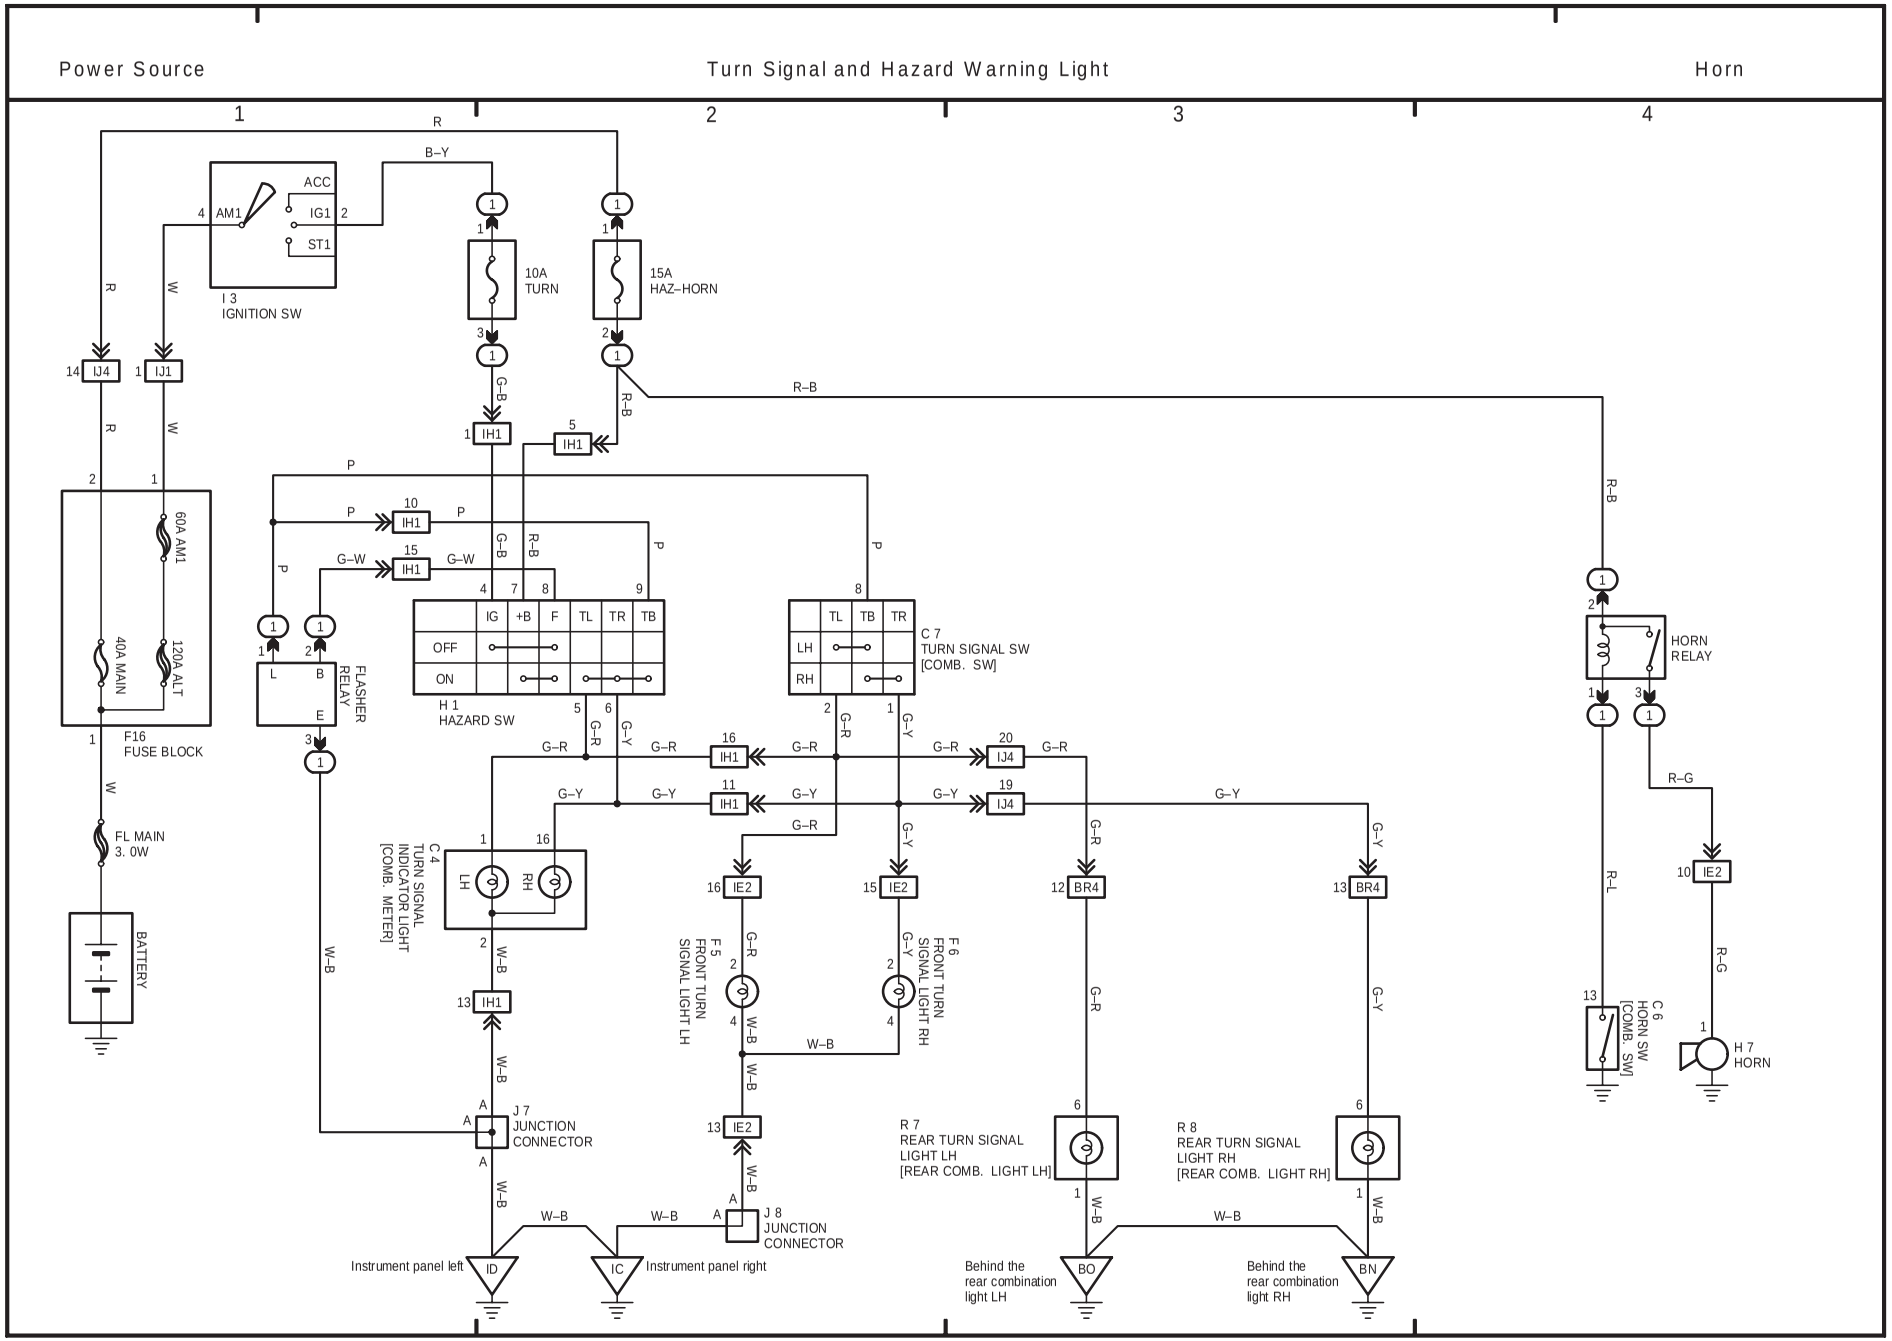

Power Source
Turn Signal and Hazard Warning Light
Horn
1
2
3
4
I 3
IGNITION SW
ACC
IG1
ST1
AM1
10A
TURN
15A
HAZ–HORN
F16
FUSE BLOCK
60A AM1
40A MAIN
120A ALT
FL MAIN
3. 0W
BATTERY
H 1
HAZARD SW
IG
+B
F
TL
TR
TB
OFF
ON
FLASHER
RELAY
C 7
TURN SIGNAL SW
[COMB. SW]
LH
RH
C 4
TURN SIGNAL
INDICATOR LIGHT
[COMB. METER]
F 5
FRONT TURN
SIGNAL LIGHT LH
F 6
FRONT TURN
SIGNAL LIGHT RH
J 7
JUNCTION
CONNECTOR
J 8
JUNCTION
CONNECTOR
R 7
REAR TURN SIGNAL
LIGHT LH
[REAR COMB. LIGHT LH]
R 8
REAR TURN SIGNAL
LIGHT RH
[REAR COMB. LIGHT RH]
HORN
RELAY
C 6
HORN SW
[COMB. SW]
H 7
HORN
Instrument panel left
Instrument panel right
Behind the
rear combination
light LH
Behind the
rear combination
light RH
ID
IC
BO
BN