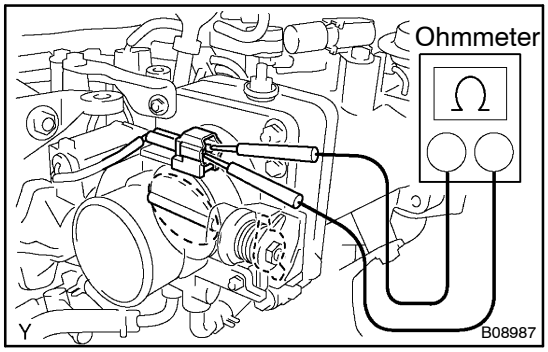


THROTTLE BODY

ED02R–05

ON–VEHICLE INSPECTION


1. INSPECT THROTTLE FULL SWITCH

(a) Disconnect the switch connector.

(b) Using an ohmmeter, check the continuity between the terminals.

Throttle Valve	Continuity
Fully closed	No continuity
Fully open	Continuity

(c) Reconnect the switch connector.

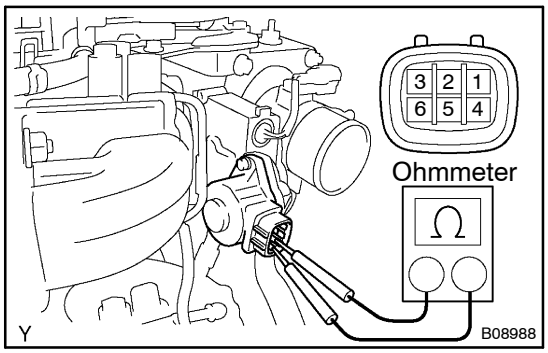

2. INSPECT THROTTLE CONTROL MOTOR

(a) Disconnect the motor connector.

(b) Using an ohmmeter, measure the resistance between terminals 1 and 2, 3 and 2, 4 and 5, and 6 and 5.

Resistance: 72 – 88 Ω at 20°C (68°F)

(c) Reconnect the motor connector.