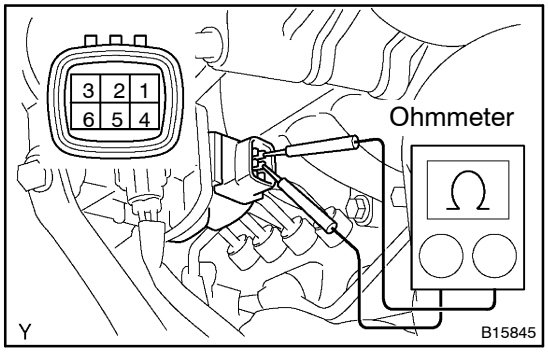


ED06B–01

INSPECTION

INSPECT THROTTLE CONTROL MOTOR

(a) Disconnect the throttle control motor connector.

(b) Using ohmmeter, measure the resistance between terminals 2 and 1/3, and 5 and 4/6.

Resistance:

Cold	15 – 28 Ω
Hot	20 – 33 Ω

HINT:

”Cold” and ”Hot” above express the temperature of the part itself. ”Cold” is from –10°C (14°F) to 50°C (122°F) and ”Hot” is from 50°C (122°F) to 100°C (212°F)