
ED04D–02

INSPECTION

INSPECT ACCELERATOR PEDAL POSITION SENSOR

(a) Disconnect the accelerator pedal position sensor connector.

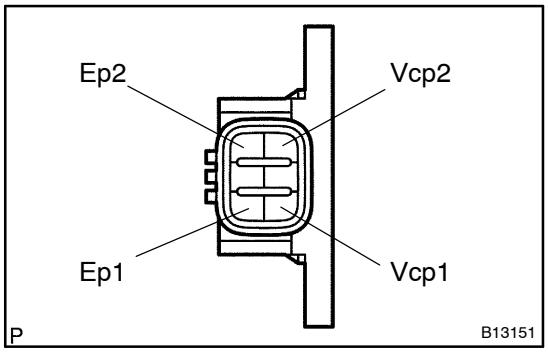

(b) Using an ohmmeter, measure the resistance between each terminals.

Resistance: at 20°C (68°F)

Terminals	Resistance
V_{CP1} – E_{P1} V_{CP2} – E_{P2}	1.5 – 6.0 kΩ