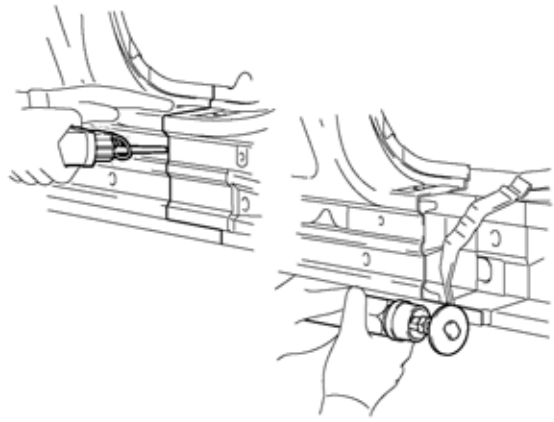
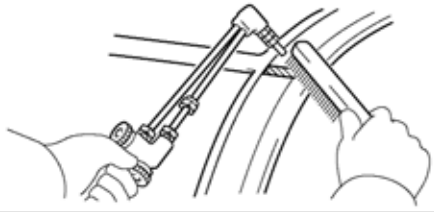
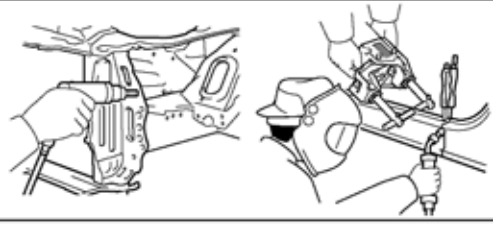
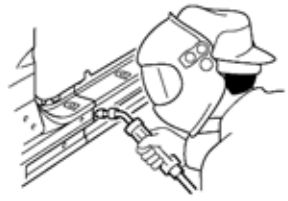
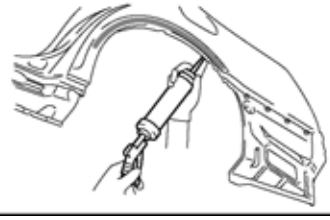

2. SYMBOLS

REPAIR AREA INDICATOR SYMBOLS		REPAIR METHOD INDICATOR SYMBOLS		ILLUSTRATION
	CUT		CUT AND JOIN LOCATION (SAW CUT)	
			CUT AND JOIN LOCATION (Cut Location for Supply Parts)	
			CUT LOCATION	
			CUT WITH DISC SANDER, ETC.	
	BRAZE		BRAZING OR ARC BRAZING FOR REMOVAL	
	BRAZE		BRAZE	
	WELD POINTS		SPOT WELD OR PLUG WELD (refer to “ILLUSTRATION OF WELD POINT SYMBOLS”)	
	WELDING		BUTT WELD	
			FILLET WELD	
	BODY SEALER		BODY SEALER	 F31237

REPAIR AREA INDICATOR SYMBOLS		REPAIR METHOD INDICATOR SYMBOLS		ILLUSTRATION
—	ASSEMBLY MARK	⊕	STANDARD HOLE FOR INSTALLATION	—
++++++++++	BODY SEALER	—	FLAT FINISHING	
———			NO FLAT FINISHING	 F31238