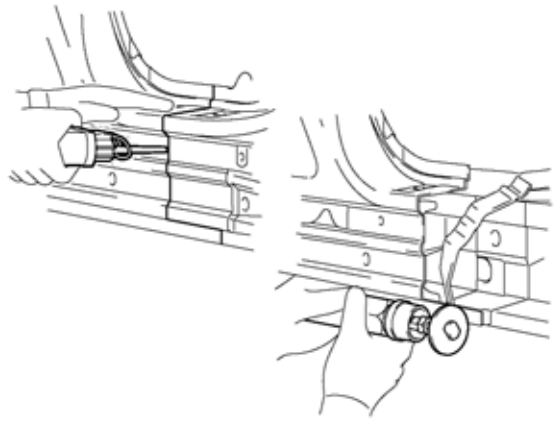
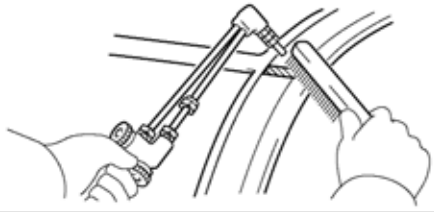
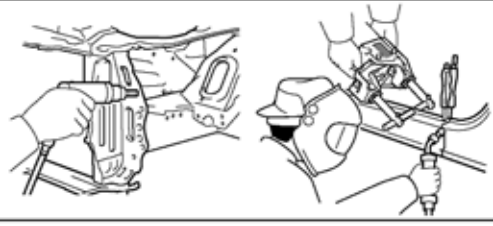
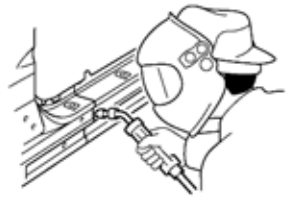
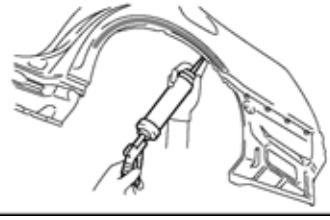

# 2. SYMBOLS

| REPAIR AREA INDICATOR SYMBOLS | | REPAIR METHOD INDICATOR SYMBOLS | | ILLUSTRATION |
|---|---|---|---|---|
| | CUT | | CUT AND JOIN LOCATION (SAW CUT) |  |
| | | | CUT AND JOIN LOCATION (Cut Location for Supply Parts) | |
| | | | CUT LOCATION | |
| | | | CUT WITH DISC SANDER, ETC. | |
| | BRAZE | | BRAZING OR ARC BRAZING FOR REMOVAL |  |
| | BRAZE | | BRAZE |  |
| | WELD POINTS | | SPOT WELD OR PLUG WELD (refer to “ILLUSTRATION OF WELD POINT SYMBOLS”) |  |
| | WELDING | | BUTT WELD |  |
| | | | FILLET WELD | |
| | BODY SEALER | | BODY SEALER |  F31237 |

| REPAIR AREA INDICATOR SYMBOLS | | REPAIR METHOD INDICATOR SYMBOLS | | ILLUSTRATION |
|---|---|---|---|---|
| — | ASSEMBLY MARK | ⊕ | STANDARD HOLE FOR INSTALLATION | — |
| ++++++++++ | BODY SEALER | — | FLAT FINISHING |  |
| ——— | | | NO FLAT FINISHING |  F31238 |