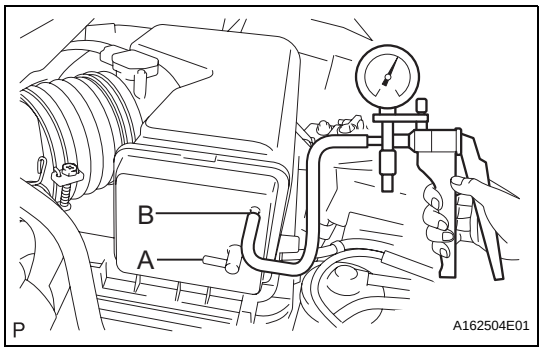


VACUUM TANK

ON-VEHICLE INSPECTION

1. INSPECT AIR CLEANER CAP SUB-ASSEMBLY

(a) Check that air flows from port B to port A.

(b) Apply 60 kPa (450 mm Hg, 18 in. Hg) of vacuum to port B. Check that there is no change of vacuum after one minute.