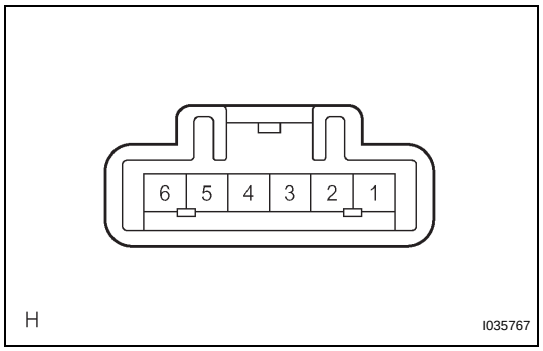


HAZARD WARNING SWITCH

INSPECTION

1. HAZARD WARNING SIGNAL SWITCH ASSEMBLY

(a) Check that there is resistance between the terminals at each switch position as shown in the chart.

Resistance

Switch operation	Tester connection	Specified condition
OFF	3 - 4	10 kΩ or higher
ON	3 - 4	Below 1 Ω
Illumination circuit	5 - 6	Below 1 Ω

(b) Inspect illumination operation.

(1) Connect the positive (+) lead from the battery to the terminal 6 and negative (-) lead to the terminal 5, then check that the illumination comes on.