

Start Injector Time Switch

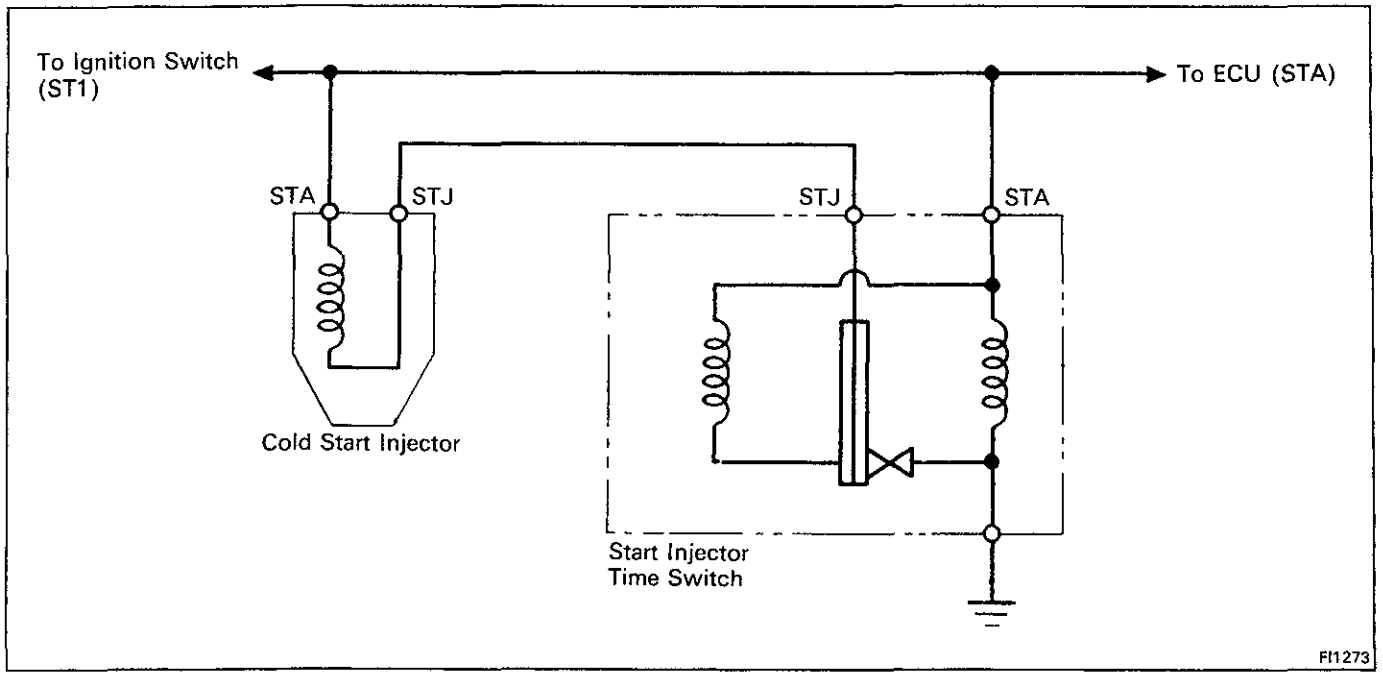

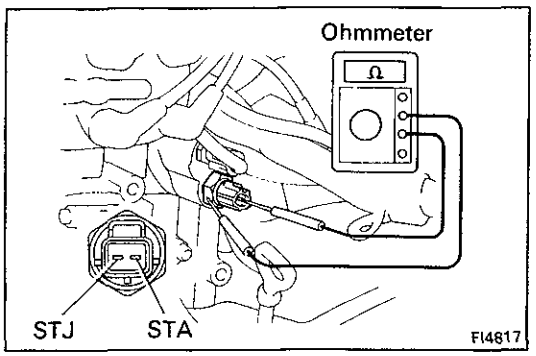

INSPECTION OF START INJECTOR TIME SWITCH

1. **MEASURE RESISTANCE OF START INJECTOR TIME SWITCH**
   (a) Disconnect the connector.
   (b) Using an ohmmeter, measure the resistance between each terminal.

Between terminals	Resistance (Ω)	Coolant temperature
STA – STJ	30 – 50	below 10°C (50°F)
	70 – 90	above 25°C (77°F)
STA – Ground	30 – 90	–