
190JF–01

INSPECTION

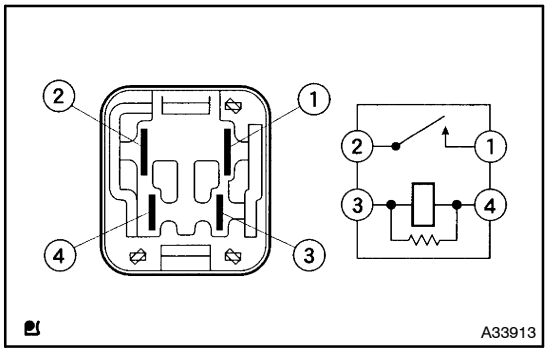

1. GLOW PLUG (SUB) RELAY ASSY

(a) Continuity inspection.

(1) Using an ohmmeter, check that there is continuity between each terminal.

Specified condition:

Between terminal	Specified condition
1 – 2	No continuity
3 – 4	Continuity

(2) Using an ohmmeter, check that there is continuity between terminals 1 and 2 when the battery voltage is applied across terminals 3 and 4.

Specified condition: Continuity