

SERVICE BULLETIN

APPLICABILITY

1990 LEGACY SEDANS AND STATION WAGONS
(NON-AIR SUSPENSION VEHICLES ONLY)

DATE

11-14-90

SUBJECT: MODIFIED REAR STRUT MOUNTS

If you encounter a customer complaint of a knocking noise from the rear of the vehicle, it will be necessary to install a set of modified strut mounts, after eliminating other possibilities.

	<u>NEW</u>	<u>OLD</u>
FWD RH:	20370AA021	20370AA020
FWD LH:	20370AA031	20370AA030
4WD RH:	20370AA001	20370AA000
4WD LH:	20370AA011	20370AA010

Modified parts are available through normal Subaru parts supply channels.

Modified parts are marked RH and LH for ease of identification.

NOTE: When installing, ensure that the locating arrow on the strut mount points towards the outer edge of the vehicle. See Fig. 1.

Outer Fender

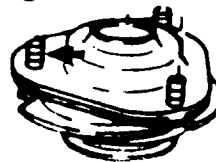


Figure 1 Strut Mount Orientation

It is necessary to transfer the rear struts in accordance with the procedures outlined in Section 4 of the 1990 Legacy Service Manual.

Please be advised that the modified strut mounts have been incorporated in production as follows:

	<u>VIN</u>	<u>PROD. DATE</u>
FWD: 4 DOOR SEDAN:	600674	AUGUST 1, 1990
STATION WAGON:	900329	
4WD: 4 DOOR SEDAN:	600715	AUGUST 10, 1990
STATION WAGON:	900362	

This procedure may be claimed under the Subaru Limited Warranty using the following information:

ITEM DESCRIPTION/ FAILURE CODE	OPERATION NUMBER	LABOR DESCRIPTIONS	TIME	
			4 DOOR	S/W
Rear Strut Mount PCZ-48	A 612-504	Both rear strut assemblies (includes removing brake lines and bleeding) R&R	1.5	1.5