

PROPELLER SHAFT

PRECAUTIONS


Be careful not to grip the propeller shaft tube too tightly in the vise as this will cause deformation.

TROUBLESHOOTING

Problem	Possible cause	Remedy	Page
Noise	Sleeve yoke spline worn Spider bearing worn or stuck	Replace sleeve yoke Replace spider bearing	PR-4 PR-4
Vibration	Propeller shaft runout Propeller shaft imbalance Sleeve yoke spline stuck	Replace propeller shaft Balance propeller shaft Replace sleeve yoke	PR-3 PR-4

PROPELLER SHAFT COMPONENTS

Front and Rear Propeller Shaft

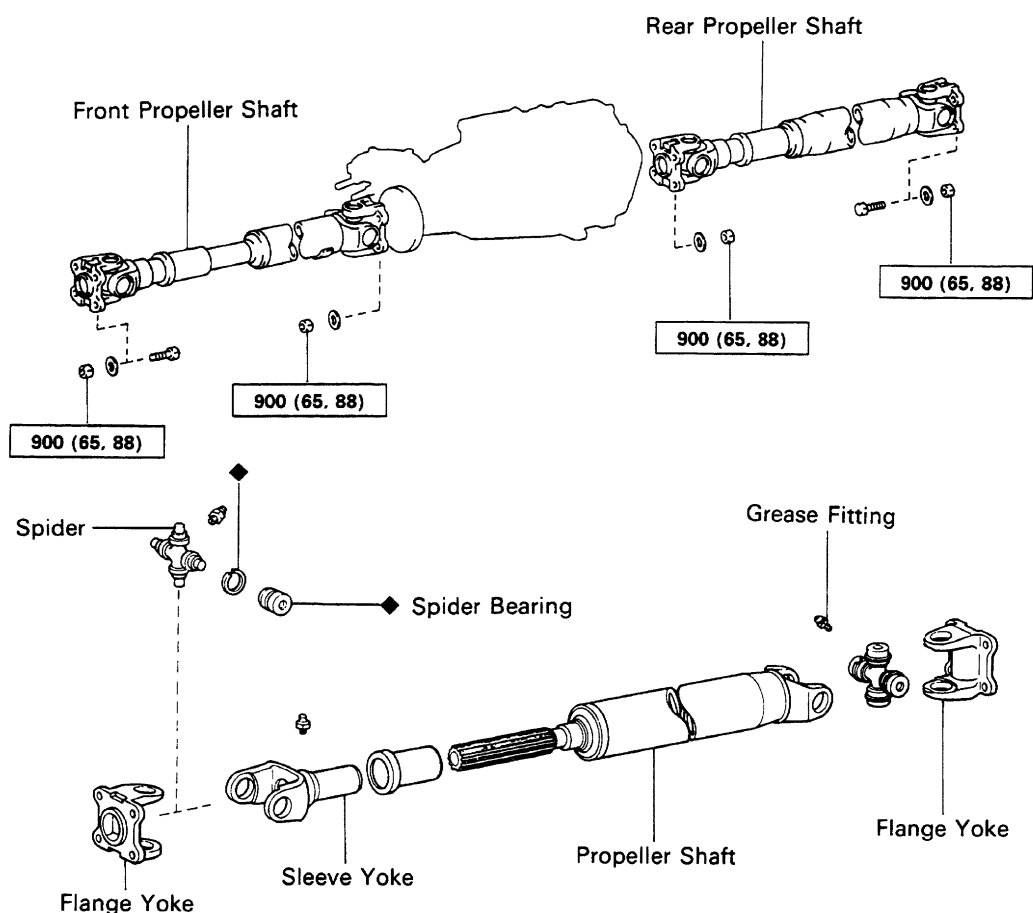

kg-cm (ft-lb, N-m) : Specified torque

◆ Non-reusable part

D3796
D3165