


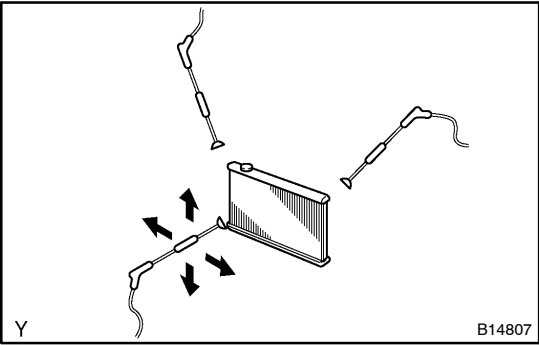

RADIATOR

ON-VEHICLE CLEANING

CO1B0-01

INSPECT FINS FOR BLOCKAGE

If fins are clogged, wash them with water or a steam cleaner and dry with compressed air.

NOTICE:

- If the distance between the steam cleaner and the core is too close, there is a possibility of damaging the fin, so keep the following injection distance.

Injection Pressure	Injection Distance
2,942 – 4,903 kpa (30 – 50 kg/cm ² , 427 – 711 psi)	300 mm (11.811 in)
4,903 – 7,845 kpa (50 – 80 kg/cm ² , 711 – 1,138 psi)	500 mm (19.685 in)

- If the fins are bent, straighten them with a screwdriver or pliers.
- Never apply water directly onto the electronic components.