


DTC	C1541 / 41	Vehicle Skid Control System Malfunction
-----	------------	---

CIRCUIT DESCRIPTION


The VGRS system will illuminate the warning light and this DTC will be recorded when some ABS/VSC system DTCs are set.

DTC No.	DTC Detecting Condition	Trouble Area
C1541/41	The system receives the information about a malfunction in the steering sensor signal or in the vehicle speed signal from ABS/VSC.	•VSC system •VGRS ECU •Skid control ECU

WIRING DIAGRAM

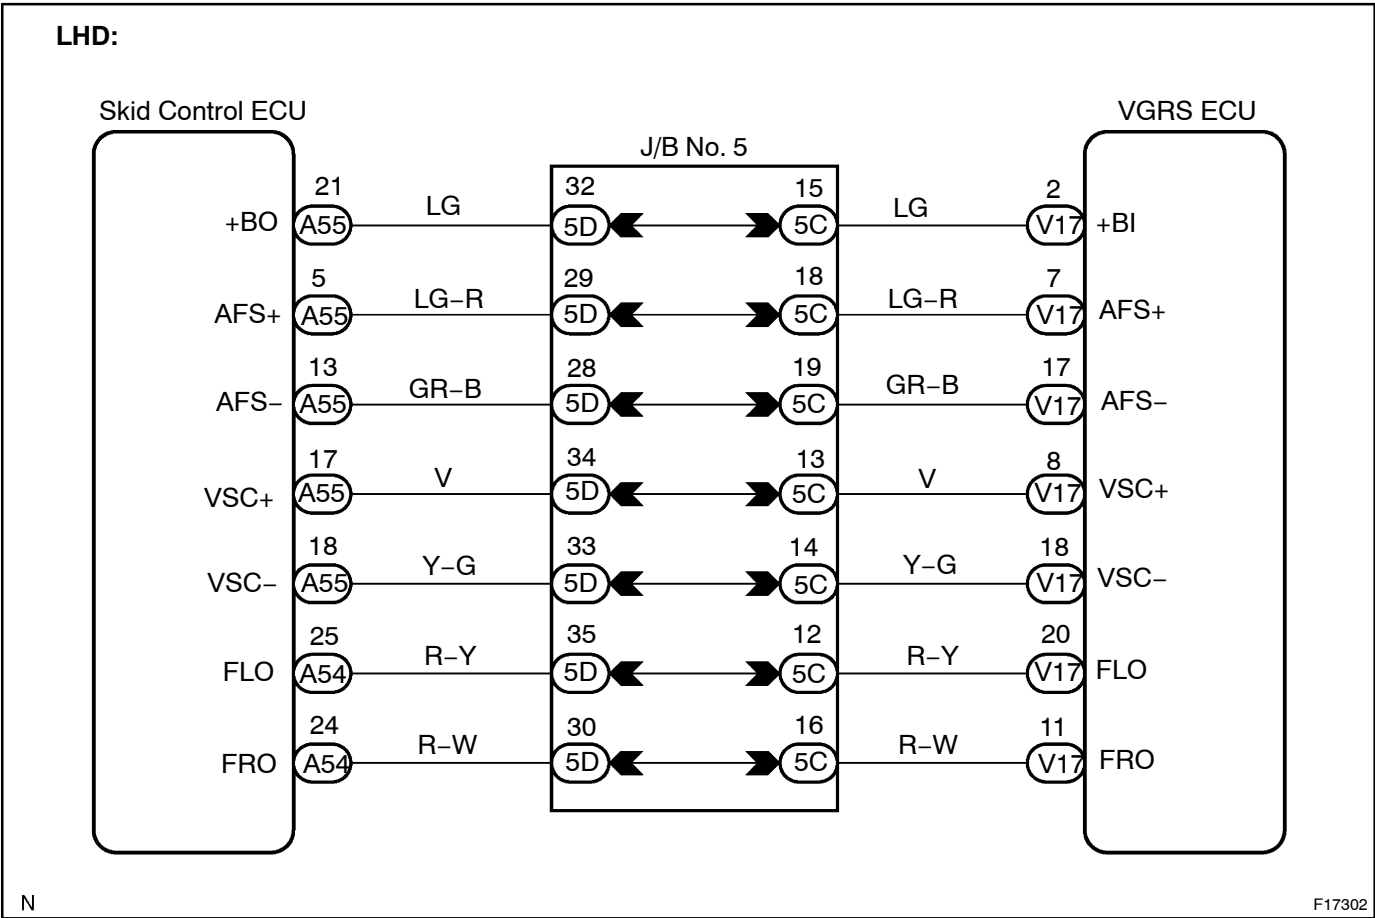

RHD:

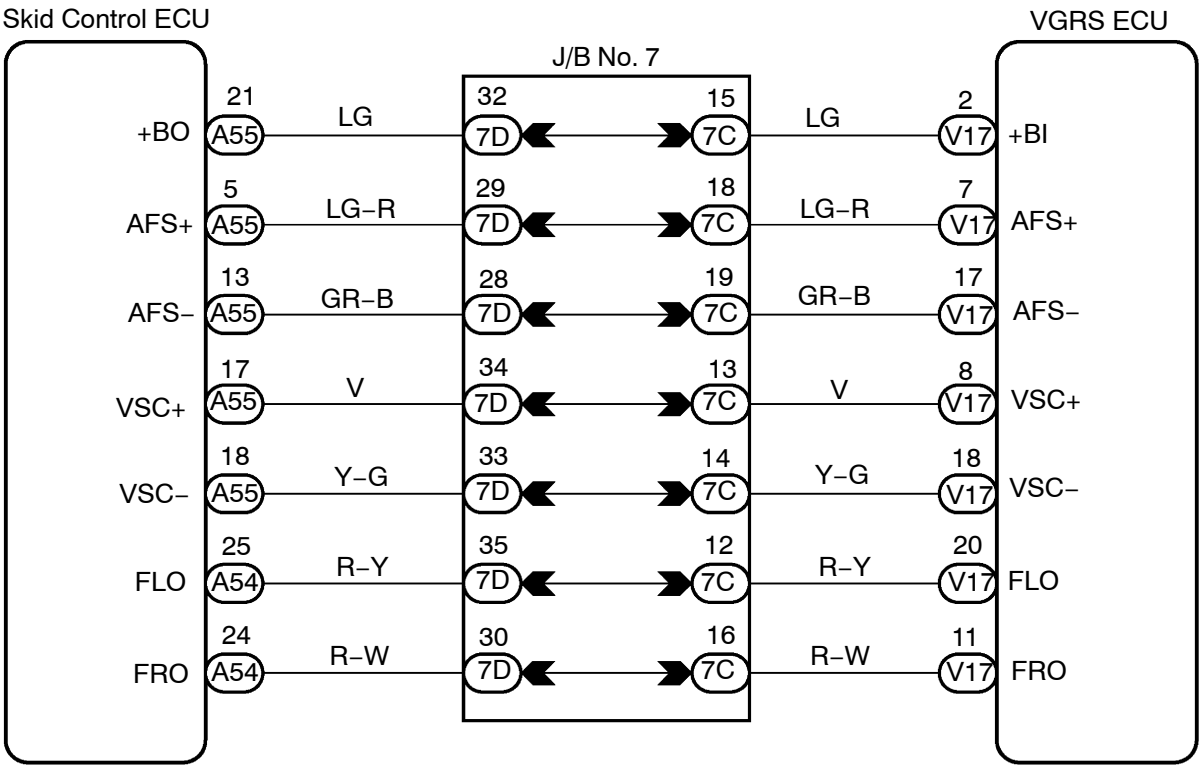

N

F17302

INSPECTION PROCEDURE

1	Check the ABS/VSC for DTCs (See Pub. No. RM970E, page DI-185).
---	--

Are any ABS/VSC DTCs present?

YES

Repair the ABS/VSC system according to the DTC output.

NO

Replace VGRS ECU.