


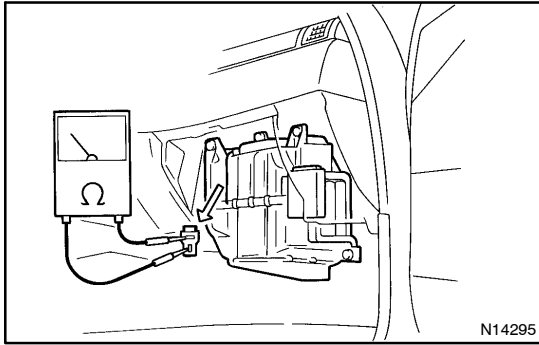

AC259-01

THERMISTOR ON-VEHICLE INSPECTION

1. REMOVE GLOVE COMPARTMENT PARTS
(See page [BO-76](#))

2. INSPECT THERMISTOR RESISTANCE

Measure the resistance between terminals.

Standard resistance:

1,500 Ω at 25 °C (77 °F)

If resistance is not as specified, replace the sensor.