


# Front Wiper Position Circuit


## CIRCUIT DESCRIPTION

This signal is taken into Body ECU. If this signal cannot be received, Body ECU does not perform reverse linked function control.

## WIRING DIAGRAM

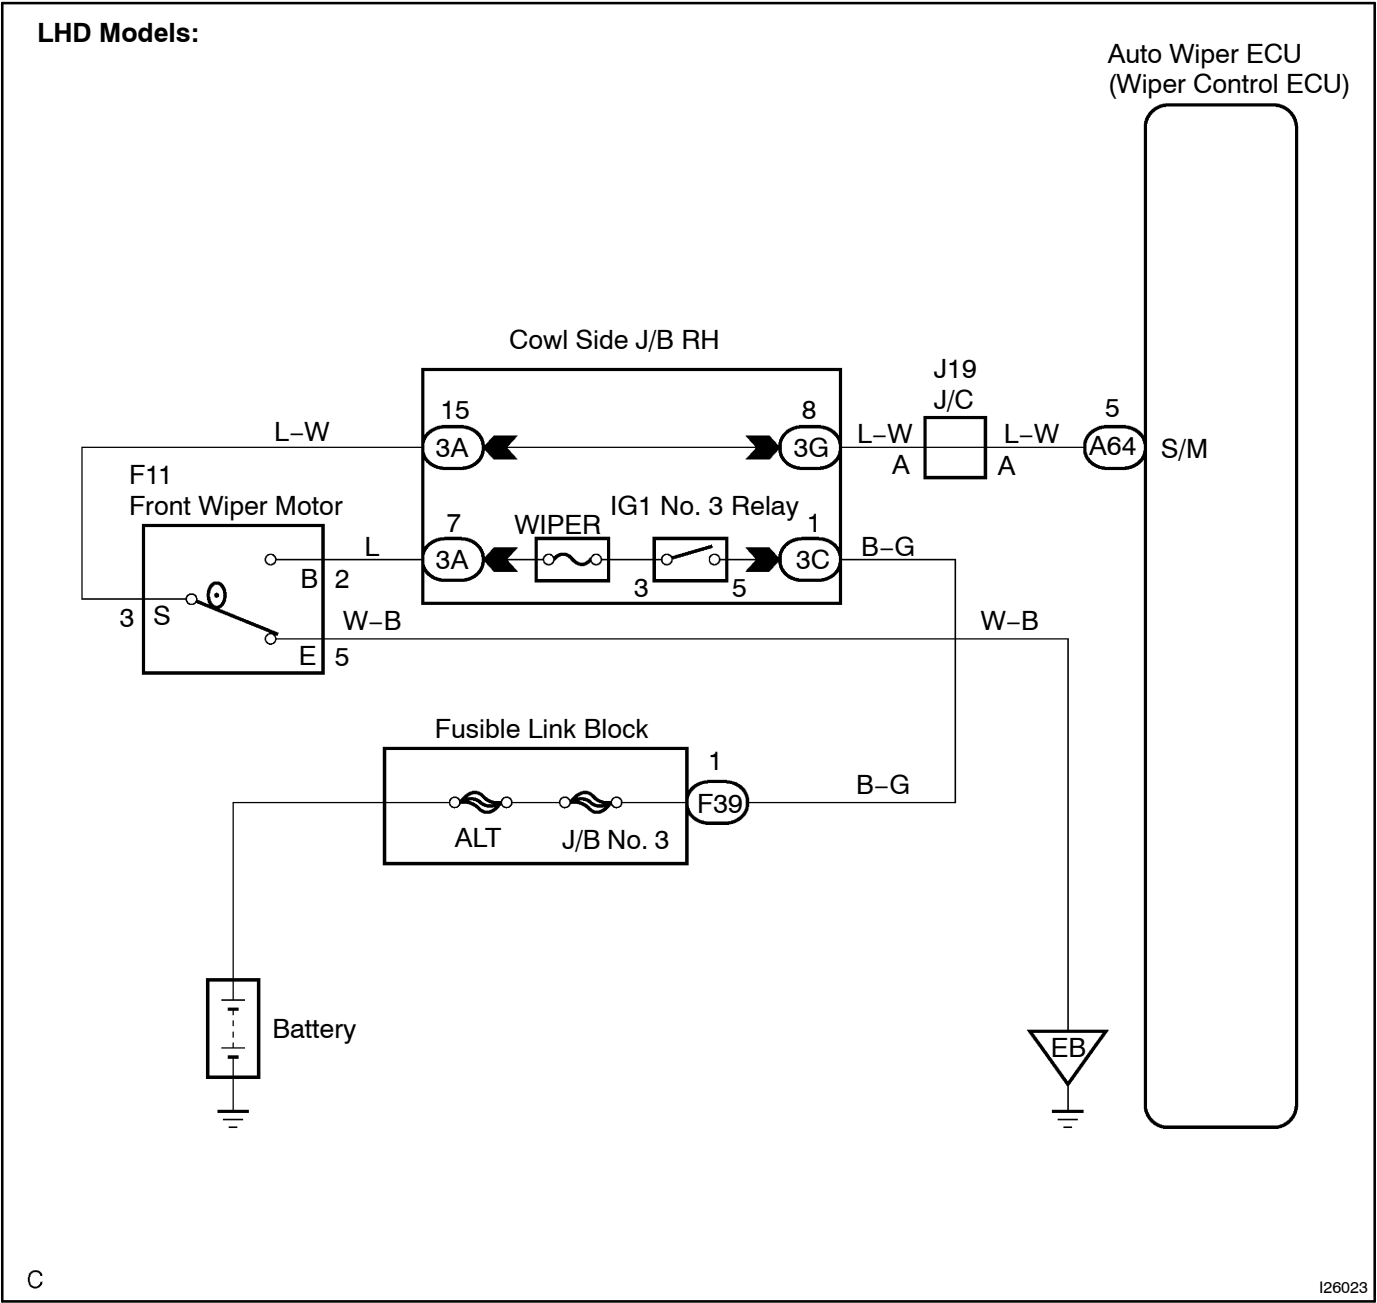

## RHD Models:

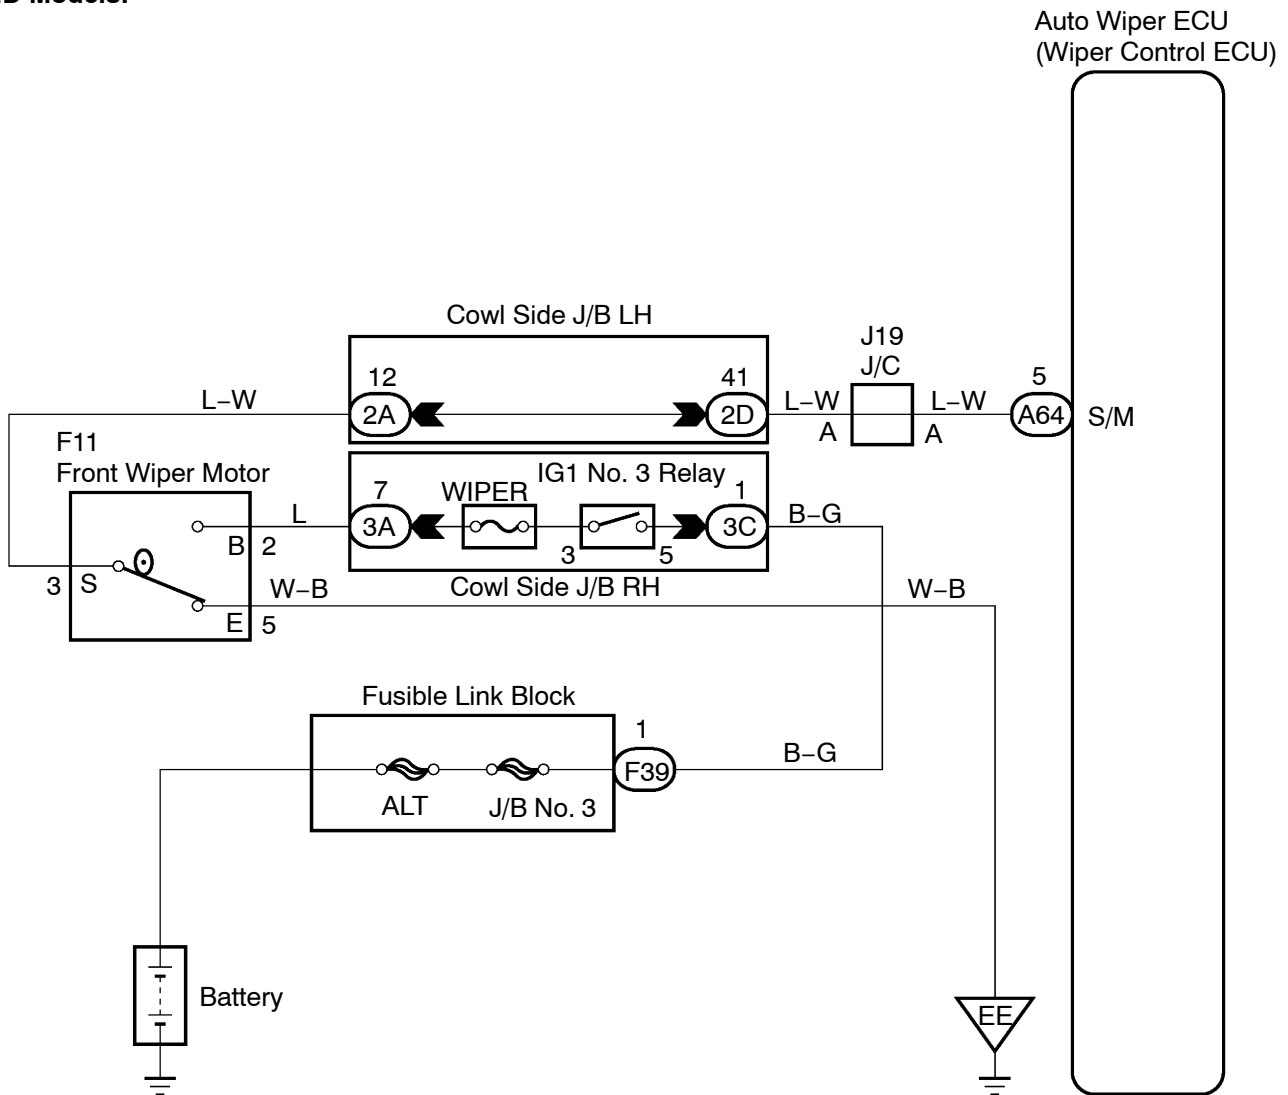

C

I26049

INSPECTION PROCEDURE

|   |                                                                                                        |
|---|--------------------------------------------------------------------------------------------------------|
| 1 | Check wire harness between wiper control ECU and front wiper motor ( <a href="#">See page IN-38</a> ). |
|---|--------------------------------------------------------------------------------------------------------|

NG

Repair or replace wire harness.

OK

|   |                                                                                               |
|---|-----------------------------------------------------------------------------------------------|
| 2 | Check wire harness between wiper control ECU and body ECU ( <a href="#">See page IN-38</a> ). |
|---|-----------------------------------------------------------------------------------------------|

NG

Repair or replace wire harness.

OK

Proceed to next circuit inspection shown on problem symptom table ([See page DI-930](#)).